

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

**CHILD SEATS:**

None during July 2012.

**EQUIPMENT:**

Deere & Company is recalling certain John Deere 8.1 liter compressed natural gas engines, model number 6081HFN04, manufactured from June 2002 through January 2008. Failures can occur within the engine turbocharger. The turbine or compressor wheel may fail, resulting in subsequent damage to the engine and/or an oil leak. Failure of the turbine or compressor wheel may result in smoke, fire and stalling. The remedy for this issue is still under development. The manufacturer has not yet provided a notification schedule. John Deere's campaign number is 12RG325.

**12E-026**

Idle Free Systems, Inc. (IFS) is recalling certain auxiliary power units (APU), model MT-HR-H-06, manufactured from February 2010 through December 2011 and installed as aftermarket equipment on heavy trucks. The APU captures excess energy produced by the truck's alternator. This energy is converted to electricity which can be used to power A/C and heat systems in the truck's cab. The battery separator contained in the APU could experience an internal circuit board capacitor failure, which could result in a fire. IFS will notify owners and the battery separator will be replaced free of charge. The safety recall is expected to begin during August 2012. Owners may contact IFS at 1-920-206-9333.

**12E-027**

**TIRES:**

BF Goodrich Commercial T/A A/S and Uniroyal Laredo HD/H tires, sizes LT235/85R16 120 Q Load Range E and LT245/75R16 120 Q Load Range E, are being recalled. These tires may develop a separation at the tread/belt edge. Tread/belt separation of the tire while the vehicle is in use can result in rapid air loss which may increase the risk of a vehicle crash. Owners will be notified by BF Goodrich and Uniroyal, and dealers will replace the affected tires free of charge. The safety recall began on August 6, 2012. Owners may contact the Tire Consumer Care line at 1-800-637-5527.

**12T-019**

**VEHICLES:**

Mack is recalling certain model year 2012 CHU, CXU, and GU vehicles, manufactured from October 10, 2011, through November 17, 2011. Hardware used to secure the windshield wiper linkage to the wiper motor may not be sufficiently torqued, and may cause the windshield wiper linkage to detach from the wiper motor. As a result, the windshield wipers will not function. If this occurs, under certain driving conditions the driver's visibility will be reduced, increasing the risk of a crash. Mack will notify owners, and replace the hardware on affected vehicles, free of charge. The safety recall is expected to begin during August 2012. Owners may contact Mack Trucks at 1-800-866-1177. Mack's recall number is SC0364.

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING JULY 2012**

*Published August 9, 2012*

### **12V-308**

Prevost is recalling certain model year 2008-2010 H3-45, model year 2009-2010 X3-45, and model year 2009 MTH XLII-45E vehicles, all equipped with Volvo D13 engines and an automatic fire detection and suppression system (AFSS). The AFSS linear thermal detector may come in contact or rub against brackets or clamps. If this occurs, the AFSS may activate with no fire present and the stop engine feature will be activated, bringing the vehicle to an unplanned stop, increasing the risk of a crash. Prevost will notify owners and dealers will inspect and secure the linear thermal detector, free of charge. The safety recall began in July 2012. Owners may contact Prevost Car Inc., service department toll-free at 1-866-870-2046 or 1-418-831-2046. The Prevost recall campaign number is SR12-20.

### **12V-309**

Zero Motorcycles, Inc. (Zero) is recalling certain model year 2012 S, DS, X, XU, and XU-LSM motorcycles. Insufficient weatherproofing may cause a short circuit of the battery management system when subjected to wet conditions, resulting in the motorcycle inadvertently losing power. Sudden loss of power can lead to a crash and potential injury or death to the rider. Zero will notify owners, and dealers will repair the motorcycles free of charge. The safety recall began on July 31, 2012. Owners may contact Zero Motorcycles, Inc. at 1-888-786-9376.

### **12V-310**

Entegra is recalling certain model year 2011-2013 Anthem and Aspire and model year 2012-2013 Cornerstone motor homes manufactured from April 19, 2011, through June 22, 2012. The windshield wiper arm can detach from the vehicle. If this occurs, the driver's visibility can be reduced, increasing the risk of a crash. Entegra will notify owners, and dealers will replace the shaft attaching the arm to the wiper linkage, free of charge. The safety recall began on July 26, 2012. Owners may contact Entegra at 1-800-945-4787.

### **12V-312**

Prevost is recalling certain model year 2009-2011 Volvo 9700 transit buses. During production, the passenger seat wall mounting tracks may have not been properly secured to the structure. In the event of a crash, there is an increased risk of personal injury to passengers. Volvo Bus will notify owners and dealers will inspect and repair the passenger seat wall tracks free of charge. Owners may contact Prevost Car Inc., service department toll-free at 1-866-870-2046 or 1-418-831-2046. The Prevost recall campaign number is SR12-61.

### **12V-313**

Navistar is recalling one model year 2008 Safari Simba diesel recreational vehicle manufactured on June 29, 2007, equipped with Bosch hydraulic brakes. Hydraulic brake equipped motorhome chassis exposed to long periods of time of non-driving may experience diametrical brake caliper piston growth and reduced piston to bore clearance potentially leading to brake drag and overheating resulting in reduced brake performance. Reduced brake performance may lead to an increased risk of a crash. Navistar will notify the owner, and an authorized Daimler Trucks North America (DTNA) dealer will inspect and, as necessary, replace the brake

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

calipers, free of charge. The safety recall began on July 20, 2012. Owners may contact DTNA at 1-800-547-0712.

**12V-314**

Prevost is recalling certain model year 2007-2009 X3-45 coaches equipped with Volvo D13 engines. The jump-start positive terminal block cable may be missing a protective sleeve, which may allow a short-circuit if it contacts other vehicle structures. If a short-circuit occurs, there is an increased risk of fire. Prevost will notify owners, and dealers will inspect the cable and, as necessary, add protective tubing free of charge. The recall began on July 17, 2012. Owners may contact Prevost at 1-418-883-2888. The Prevost recall campaign number is SR12-24.

**12V-315**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Columbus Car Audio on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto detailer by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck.com>. You can also call Webasto toll-free at 1-888-749-8632.

**12V-316**

Volvo is recalling certain model year 2011-2013 S80 vehicles. A software error may prevent the transmission from downshifting such as shifting from fifth to fourth gear when coasting. This may result in decreased engine rpms and possible engine stall, increasing the risk of a crash. Volvo will notify owners, and dealers will upgrade the software to the transmission control module, free of charge. The safety recall is expected to begin during August 2012. Owners may contact Volvo cars at 1-800-458-1552. The Volvo recall campaign number is 255.

**12V-317**

Ford is recalling certain model year 2012 F-650 and F-750 vehicles manufactured from February 1, 2012 through March 16, 2012. The clear and black primer may be missing on certain windshields which may result in an insufficient bond between the glass and cab structure. An insufficient bond may result in a separation of the windshield from the cab, increasing the risk of personal injury or death. Ford will notify owners, and dealers will remove and inspect the windshield for urethane adhesion, and replace or reinstall the windshield as required, free of charge. The recall began on July 31, 2012. Owners may contact Ford at 1-866-436-7332. Ford's recall

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

campaign number is 12S33.

**12V-318**

Ford is recalling certain model year 2013 Escape vehicles manufactured from March 8, 2012 through June 7, 2012. Due to mis-positioned carpet padding the center console trim panel may be pushed outboard of the intended position, reducing clearance relative to the pedal package. The reduced clearance may result in the driver's foot contacting the side of the brake pedal while transferring the foot from the accelerator pedal to the brake pedal, increasing stopping distances and the risk of a crash. Ford will notify owners, and dealers will remove the carpet padding and left-side console trim panel replaced with a new panel, free of charge. The recall began on July 20, 2012. Owners may contact Ford at 1-866-436-7332. Ford's recall campaign number is 12S34.

**12V-319**

Glaval is recalling certain buses equipped with Braun Century-2 and/or Vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. Glaval will notify owners, and the repairs will be performed by authorized Braun dealers free of charge. Owners may contact Glaval Bus at 1-800-347-7440.

**12V-321**

Van Hool is recalling certain model year 2011-2012 TD925 motorcoaches. In the affected vehicles, the driver's seat had an incorrect riser and floor adapter plate installed during production, which may not withstand the potential forward forces experienced in a crash. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 207, "Seating Systems." In the event of a crash, there is an increased risk of injury to the driver. Van Hool will notify owners via its dealer ABC Bus, Inc. and replace the riser and floor adapter plates free of charge. The recall is expected to begin on, or before, September 15, 2012. Owners may contact the warranty administrator for ABC Bus, Inc. toll free at 1-877-427-7278. Van Hool's recall campaign number is P698.

**12V-323**

North American Bus Industries (NABI) is recalling certain model year 2003-2011 45CLFW transit buses manufactured from July 1, 2003, through December 1, 2011. The vehicles may have a loose connection in the joint between the steering pitman arm and a tapered splined shaft on the steering gear. The splines may wear over time resulting in loss of steering control. A loss of steering control could result in a crash, increasing the risk of injury. NABI will inspect and repair vehicles, as necessary, free of charge. The safety recall began on August 7, 2012. Owners may contact NABI at 1-256-831-4296. NABI's recall campaign number is 20123.

**12V-324**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

Prevost is recalling certain model year 2013 X3-45 motor coaches, manufactured from May 4, 2012, through July 6, 2012. The front suspension radius rods may not be properly torqued. As a result, the rods could detach.

If this occurs, the driver may suddenly lose control of the vehicle, increasing the risk of a crash. Prevost will notify owners and dealers will inspect and retorque the front suspension bolts, free of charge. The safety recall is expected to begin during August 2012. Owners may contact Prevost Car Inc., service department toll-free at 1-866-870-2046 or 1-418-831-2046. The Prevost recall campaign number is SR12-25.

**12V-325**

Nissan is recalling certain model year 2012 Juke vehicles manufactured from February 3, 2012, through May 26, 2012. Due to an incomplete weld penetration, the rear seat back striker may partially separate in a crash. In the event of a crash, the rear seat back may not be secured, increasing the risk of injury to the rear seat occupants. Nissan will notify owners, and dealers will replace the affected seat back strikers, free of charge. The safety recall began on July 20, 2012. Owners may contact Nissan Customer Service at 1-800-647-7261.

**12V-328**

Porsche is recalling certain model year 2011-2012 Panamera Turbo, 2012 Panamera Turbo S, and 2012 Cayenne Turbo vehicles. The turbine wheel of a turbocharger may fracture due to a casting defect. If a fracture occurs, vehicle performance will be decreased and the turbine shaft may fracture. If the shaft fractures, oil may be drawn into the exhaust system, resulting in smoke and the increased risk of a fire. Porsche will notify owners, and dealers will replace the turbine wheels, free of charge. The recall is expected to begin during August 2012. Owners may contact Porsche at 1-800-767-7243. Porsche's safety recall number is AC04.

**12V-329**

Turtle Top is recalling certain model year 2010 through 2012 commercial buses manufactured from April 1, 2011, through March 25, 2012, equipped with Specialty Manufacturing Inc. (SMI) Prolo roof hatches. Increased friction between the rear plate assemblies, p/no. 009327, and the nylon rear pop-up support, p/no. 008956, may result in an opening force of the Prolo roof hatches that exceeds Federal standard requirements. Thus, these hatches fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 217, "Bus Emergency Exits and Window Retention and Release." In the event of an emergency, passenger's exit from the bus may be hindered possibly resulting in injury to the vehicle occupants. Turtle Top will notify owners. SMI will provide service kits along with repair instructions to dealers and owners, free of charge. The safety recall is expected to begin during August 2012. Owners may contact Turtle Top at 1-574-831-4349 or SMI at 1-800-951-7867.

**12V-330**

Volkswagen is recalling certain model year 2012 Beetle vehicles. Some vehicles may be equipped with summer tires that fail to comply with federal motor vehicle safety standards 110 "Tire Selection and Rims" and 139 "New Pneumatic Tires for Light Vehicles." Improper tires may lead to the tires being over-loaded and/or under-inflated, increasing the risk of a vehicle crash. Volkswagen will notify owners, and replace the noncompliant tires, free of charge. The safety recall is expected to begin in September 2012. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

Volkswagen at 1-800-822-8987. Volkswagen's safety recall number is 44K8/W4.

**12V-331**

Paccar is recalling certain model year 2013 Kenworth T680 vehicles, manufactured from January 19, 2012, through May 15, 2012. The upper bunk restraint belt and buckle assembly may be less than the specified strength. In the event of a crash or sudden vehicle deceleration, an unexpected unlatching of the upper bunk restraint harness buckle could occur, increasing the risk of personal injury to an occupant. Paccar will notify owners, and dealers will replace the upper bunk restraints in the affected vehicles. The safety recall is expected to begin during August 2012. Owners may contact Kenworth at 1-425-828-5440. Kenworth's recall number is 12KWD.

**12V-332**

Paccar is recalling certain model year 2013 Kenworth T680 vehicles, manufactured from January 19, 2012, through May 15, 2012. The warning label located on the front of the upper bunk may deform after installation, making the text unreadable. If the warning label is not readable, the occupant may be unaware of the safety recommendations and be at an increased risk of personal injury in a crash or sudden vehicle deceleration. Paccar will notify owners, and dealers will replace the warning label in the affected vehicles. The safety recall is expected to begin during August 2012. Owners may contact Kenworth at 1-425-828-5440. Kenworth's recall number is 12KWE.

**12V-333**

Nova Bus is recalling certain model year 2012 Nova LFS transit buses equipped with certain Bendix brake valves, treadle assemblies, and/or plunger kits. The brake valve plunger may fracture after brake application, resulting in reduced brake pedal angle and travel. This condition may limit the driver's ability to deliver full pressure from the foot brake valve. There is also the potential that the brake plunger could become lodged and prevent the release of the service brakes. This condition could reduce braking ability and lead to loss of vehicle control, increasing the risk of a crash. Nova Bus will notify owners and repair the vehicles that contain the brake valves, treadle assemblies, and plunger kits, free of charge. The safety recall began on August 7, 2012. Owners may contact Nova Bus at 1-800-350-6682 or Bendix at 1-440-329-9386. This is Nova Bus campaign number CR1875A.

**12V-334**

Texas Pride Trailers (Texas Pride) is recalling certain model year 2012 DTFLB trailers, equipped with Dexter Axle brand electric/hydraulic (E/H) brake actuator pumps. Some of these pumps may not have been properly heat treated. This condition can cause premature wear of some critical components in these pumps which can render the unit inoperable. The E/H brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash. Texas Pride will notify owners, and Dexter Axle dealers will replace the actuators, free of charge. The safety recall is expected to begin during August 2012. Owners may contact Texas Pride Trailers at 1-936-349-6038, or Dexter Axle at 1-800-400-2164.

**12V-335**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

Ford is recalling certain model year 2013 Escape vehicles manufactured from October 5, 2011, through July 11, 2012, and equipped with a 1.6L engine. These vehicles have an engine compartment fuel line which may split, resulting in a leak. If this leak occurs in the presence of an ignition source, there is an increased risk of a fire and/or personal injury. Ford will notify and instruct owners to stop driving their vehicles and contact a Ford or Lincoln dealer to arrange pick-up of their vehicle. Customers will be provided with a rental vehicle if needed. The dealer will replace the engine compartment fuel line, free charge. The recall began on July 19, 2012. Owners may contact Ford at 1-866-436-7332.

**12V-336**

Prevost is recalling certain model year 2011-2013 X3-45 and XLII Entertainer Bus vehicles, manufactured from November 24, 2010, through July 3, 2012. The power cable may come in contact, or rub against sharp, abrasive edges. If this occurs, a short-circuit, or fire may result, increasing the risk of personal injury. Prevost will notify owners, and dealers will inspect and, as necessary, repair the power cables free of charge. The safety recall is expected to begin during August 2012. Owners may contact Prevost Car Inc., service department toll-free at 1-866-870-2046 or 1-418-831-2046. The Prevost recall campaign number is SR12-26.

**12V-337**

Honda is recalling certain model year 2012 Honda CR-V and model year 2013 Acura ILX vehicles. If the manual or power door lock is activated while an interior front door handle is being operated by an occupant, the cable connecting the interior door handle to the door latch mechanism may become loose and move out of position. There is a possibility that the cable can move far enough out of position to prevent the door from properly latching. If the door is not fully latched, the door may open while driving or in a crash, increasing the risk of personal injury to the vehicle occupants. Honda will notify owners, and dealers will replace the front door latch assemblies in the affected vehicles, free of charge. Additionally, the interior front door handles in certain Honda CR-Vs will also be replaced, free of charge. The safety recall is expected to begin on, or about, August 16, 2012. Owners may contact Honda customer service at 1-800-999-1009.

**12V-338**

Navistar is recalling certain model year 2010-2011 International Lonestar vehicles, manufactured from January 29, 2009, through February 21, 2011 and equipped with the Harley Davidson option package with feature codes 27DRV and 28DRV. Over time, due to corrosion and fatigue, the wheels may crack, resulting in possible wheel separation from the vehicle. If this occurs, the driver may lose control of the vehicle, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the affected wheels, free of charge. Navistar has not provided a notification schedule. Owners may contact Navistar at 1-260-461-1890. Navistar's recall campaign number is 12521.

**12V-339**

Collins is recalling certain model year 2012 Collins, Mid-Bus, or Corbeil SL, SH, DH, and DE model school and multi-function school activity buses manufacturer from March 15, 2012, through July 2, 2012, equipped with Spectal split sash emergency egress windows. The split sash windows fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 217, "Bus Emergency Exits and Window Retention and Release." The windows may have an improperly installed retainer bar, insufficient strength of the egress window latch

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

connecting rod, and/or missing or failed window fasteners. Collins will notify owners, and dealers will repair the buses free of charge. The safety recall is expected to begin on, or about, September 20, 2012. Owners may contact Collins at 1-800-533-1850.

**12V-340**

Forest River is recalling certain model year 2005-2011 Berkshire and Charleston Motorhomes, equipped with an IOTA ITS-50R transfer switch. These switches may experience heat related failures when exposed to elevated electrical loads associated with RV use in higher ambient temperatures. The failure may lead to an increased risk of electrical damage to other appliances. Continued use of the vehicle without replacing the transfer switch increases the risk of fire, personal injury, and property damage. Forest River will notify owners, and dealers will replace the Iota ITS-50R transfer switch, free of charge. The recall is expected to begin during August 2012. Owners may contact Forest River at 1-574-295-8749.

**12V-341**

Collins is recalling certain model year 2012 Collins, Mid-Bus, and Corbeil SL, SH, DH, and DE model school and multi-function school activity buses manufactured from March 12, 2012, through July 2, 2012. The electrical panel cover above the driver may not be adequately secured. Vibration can cause the designed disks to lose grip and release the cover without warning. The panel could fall and injure or distract the driver, leading to a crash. Collins will notify owners, and dealers will repair the buses free of charge. The safety recall is expected to begin on, or about, September 20, 2012. Owners may contact Collins at 1-800-533-1850.

**12V-342**

Kawasaki is recalling certain model year 2008-2012 Concours 14 (ZG1400 A/B/C) motorcycles. Due to a gap between the brake pedal and guard, small stone or debris can become trapped, creating a brake drag. This can cause the rear brake to overheat, leading to rear brake damage and lock-up or failure of the rear brakes. The front brakes may also be affected on ZG1400C models. If the brakes lock up or fail, there is an increased risk of a crash. Kawasaki will notify owners, and dealers will install a guard on the brake pedal, free of charge. The safety recall began on July 27, 2012. Owners may contact Kawasaki at 1-866-802-9381.

**12V-343**

Double K is recalling certain model year 2007-2009 Hometown Trolley Villager and model year 2009 Hometown Trolley Mainstreet vehicles equipped with a Braun Vista-2 or Century-2 wheelchair lift. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. Double K will notify owners, and the repairs will be performed by authorized Braun dealers free of charge. Double K has not provided a notification schedule. Owners may contact Double K at 1-478-822-2242.

**12V-344**

Collins is recalling certain model year 2012 Collins, Corbeil, and Mid-Bus school bus and multi-function school activity buses, models SL400, SH400, DH400, DH416 with 139" wheel base and two-passenger seat set at 24,



**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

25, 26, 27, or 28" hip to knee spacing and three-passenger seat set at 24, 25, or 26" hip to knee spacing and model year 2012 DH500 and DH516 with 159" wheel base and two-passenger seat set at 28 or 29" hip to knee spacing and three-passenger seat set at 27, 28, or 29" hip to knee spacing. These buses were manufactured from March 12, 2012, through July 11, 2012. In some floor plans on these models of buses, there is the possibility that the fuel filler hose was damaged during seat or seat track installation or that a seat bolt and/or the seat bolt bracket interferes with the routing of the fuel fill hose. The fuel fill hose runs from the exterior of the bus, through a housing in the bus, then under the bus and toward the fuel tank. Some floor plans have a seat or track bolt that comes through the floor near the area where the hose crosses the chassis frame. In addition to possible damage during installation, there is a chance that the bolt or the bracket can abrade or puncture the hose in this area. If the integrity of this hose is breached, fuel could spill. In the case of gasoline or diesel vehicle, fuel could spill during fueling operations or in the event of a crash, increasing the risk of a fire. In the case of a propane vehicle, propane gas could be released during fueling operations (check valves prevent release from the tanks) creating the risk of a fire during filling. Collins will notify owners, and dealers will repair the buses free of charge. The safety recall is expected to begin on or about September 20, 2012. Owners may contact Collins at 1-800-533-1850.

**12V-345**

Collins is recalling certain model year 2012 Collins, Mid-Bus, or Corbeil SL, SH, DH, and DE model school and multi-function school activity buses manufacturer from March 12, 2012, through July 3, 2012. When the Double Out Door is open, there is potential for a drawstring of a backpack or an article of clothing to become entangled in a gap at the door bracket or support hardware as a passenger is exiting the bus. If a drawstring or any other article of clothing worn by a passenger is entangled or snagged by the handrail, the bus operator may not be aware that the passenger is caught and could move the bus, potentially pulling the passenger under the wheels. This situation could lead to injury or even death. Collins will notify owners, and dealers will repair the buses free of charge. The safety recall is expected to begin during September 2012. Owners may contact Collins at 1-800-533-1850.

**12V-346**

Jayco is recalling certain model year 2007 Greyhawk Class C motorhomes; model year 2008 and 2010 Seneca Class C motorhomes; model year 2009 and 2011 Eagle Fifth-wheel; 2010 Recon fifth-wheel; and model year 2008-2010 Designer fifth wheel vehicles manufactured from June 15, 2006, through August 13, 2010 for an improper electrical connection at the buss bar on the Iota-brand transfer switches installed in the vehicles. An improper electrical connection at the buss bar could lead to overheating and melting of the transfer switch, increasing the risk of a fire, injury or death. Jayco will notify owners, and dealers will replace the transfer switch, free of charge. The safety recall is expected to begin during August 2012. Owners may contact Jayco at 1-800-283-8267.

**12V-347**

Elkhart Coach is recalling certain model year 2011 and 2012 transit buses, models 9215-0200 and 9250-0700, equipped with ProLo bus roof escape hatches. Increased friction between the rear plate assemblies, may result in an opening force of the ProLo roof hatches that exceeds Federal standard requirements. Thus, these hatches fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 217, "Bus Emergency Exits

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

and Window Retention and Release." In the event of an emergency, a noncompliant hatch may not provide a means of readily accessible egress, increasing the risk of injury to the vehicle occupants. Elkhart Coach will notify the owners, and these buses will be repaired free of charge. The safety recall began during July 2012. Owners may contact Elkhart at 1-574-264-5179.

**12V-348**

Blue Bird is recalling certain model year 2013 Vision school buses manufactured from May 10, 2012, through June 7, 2012. The electronic module that activates the hydraulic brake pressure indicator light on the dash instrument panel when there is little, or no, pressure in the hydraulic brake system may have been omitted during manufacturing. Therefore, these buses fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 105, "Hydraulic and Electric Brake Systems," Section 5.3 "Brake System Indicator Lamps". In the event that a loss of pressure occurs in the hydraulic brake system and the brake pressure monitor does not activate, the operator of the bus may not be aware of the subsequent reduced braking capacity which could result in a vehicle crash with potential for personal injury and/or property damage. Blue Bird will notify owners, and dealers will repair the buses free of charge. The safety recall is expected to begin on or about August 23, 2012. Owners may contact Blue Bird at 1-478-822-2242.

**12V-349**

Crossroads is recalling certain model year 2010 and 2011 Hampton travel trailers manufactured from June 11, 2009, through November 2, 2010, equipped with Atwood Mobile Products (Atwood) furnaces. The furnaces were produced with a defective gas control valve which can stick in the open position. If the gas valve sticks in the open position, gas could leak out and, in the presence of an ignition source, result in a fire. Crossroads will notify owners, and dealers will repair the furnaces, free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact Crossroads Warranty Service Department at 1-855-226-7496.

**12V-350**

Hyundai is recalling certain model year 2012-2013 Hyundai Sonata passenger cars, manufactured from January 24, 2012, through June 21, 2012. The curtain side airbags on these vehicles may inflate without deployment command due to an error during manufacturing. The curtain airbag may inflate without deployment command and increase the risk of injury to occupants of the vehicle. Additionally, an unexpected deployment would be a significant driver distraction and would limit the driver's visibility, increasing the risk of a crash. Hyundai dealers will notify owners, and dealers will replace the curtain side airbags free of charge. This recall is expected to begin during August 2012. Owners may contact Hyundai at 1-800-633-5151. Hyundai's recall campaign number is 106.

**12V-352**

Ford Motor Company is recalling certain model year 2001 through 2004 Escape vehicles equipped with 3.0L V6 engines and speed control manufactured from October 22, 1999, through January 23, 2004. Inadequate clearance between the engine cover and the speed control cable connector could result in a stuck throttle when the accelerator pedal is fully or almost-fully depressed. This risk exists regardless of whether or not speed control (cruise control) is used. A stuck throttle may result in very high vehicle speeds and make it difficult to stop

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING JULY 2012**

*Published August 9, 2012*

or slow the vehicle, which could cause a crash, serious injury or death. Ford will notify owners, and dealers will repair the vehicles by increasing the engine cover clearance, free of charge. The safety recall is expected to begin on, or before, August 6, 2012. Remedy parts are expected to be available in mid-August 2012. Until then dealers will disconnect the speed control cable as an interim remedy, if parts are not available at the time of an owner's service appointment. Owners may contact Ford at 1-866-436-7332.

**12V-353**

Hyundai is recalling certain model year 2007 through 2009 Santa Fe vehicles manufactured from April 19, 2006, through July 7, 2008. The occupant classification system (OCS) may need recalibration to accurately detect small statured adults. Improper classification or detection may cause the front passenger airbag not to deploy in the event of a crash, increasing the risk of injury to the front passenger. Hyundai will notify owners, and dealers will update the classification software free of charge. The safety recall is expected to begin during August 2012. Owners may contact Hyundai at 1-800-633-5151. Hyundai's recall campaign number is 105.

**12V-354**

Keystone RV Company (Keystone) is recalling certain model year 2010-2012 Cougar 26SAB and 29RES recreational vehicles manufactured from October 5, 2009, through October 24, 2011. The rear bumper, which holds the spare tire assembly, may experience metal fatigue causing the spare tire to separate from the vehicle. Over time, the bumper may fail and/or separate from the vehicle, increasing the risk of personal injury and property damage. Keystone will notify owners, and dealers will install a reinforcement kit free of charge. The safety recall is expected to begin during August 2012. Owners may contact Keystone at 1-866-425-4369. Keystone's recall campaign number is 12-178.

**12V-355**

Eldorado National - Kansas (Eldorado) is recalling certain model year 2007 through 2011 Aerotech, Aerolite, Aero Elite, and Transtech buses equipped with Braun Century-2 and Vista-2 wheelchair lifts. Over time, and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. Eldorado will notify owners, and dealers will repair vehicles free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact Eldorado at 1-800-955-9086 or Braun at 1-800-488-0359.

**12V-356**

Mazda is recalling certain model year 2001 through 2006, and 2008, Tribute vehicles equipped with 3.0L V6 engines and speed control. Inadequate clearance between the engine cover and the speed control cable connector could result in a stuck throttle when the accelerator pedal is fully or almost-fully depressed. This risk exists regardless of whether or not speed control (cruise control) is used. A stuck throttle may result in very high vehicle speeds and make it difficult to stop or slow the vehicle, which could cause a crash, serious injury or death. Mazda will notify owners, and dealers will repair the vehicles by increasing the engine cover clearance, free of charge. The safety recall is expected to begin on, or before, August 6, 2012. Remedy parts are expected to be available in mid-August 2012. Until then dealers will disconnect the speed control cable as an

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

interim remedy, if parts are not available at the time of an owner's service appointment. Owners may contact Mazda Customer Assistance Center at 1-800-222-5500, option #6. Mazda's recall campaign number is 6812G.

**12V-357**

Daimler Trucks North America (DTNA) is recalling two model year 2013 Saf-T-Liner C2 Thomas Built school buses manufactured from April 18, 2012, through May 11, 2012, and equipped with Detroit Axle brand front axle knuckles. The front knuckles on these vehicles may have a machining error in the wheel bearing area which may lead to premature spindle failure. If the spindle fails, the wheel may separate from the knuckle, resulting in loss of vehicle control, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect and replace the affected components, free of charge. The recall is expected to begin on, or before, August 11, 2012. Owners may contact Daimler Trucks North America toll free at 1-800-547-0712. DTNA's recall campaign number is FL-629.

**12V-358**

Blue Bird is recalling model year 2013 All American and Vision school buses manufactured from April 30, 2012, through June 23, 2012. Driver's seat belts may have been inadvertently installed with mismatched buckles which fails to conform to the requirements of Federal Motor Vehicle Safety Standard No. 209, "Seat Belt Assemblies." The latch plate (tongue) on one style buckle may mate up to another style buckle receiver, but the latch plate may not be properly engaged. Should this condition occur, the seat occupant may not be properly restrained and could be injured in an accident or sudden stop. Blue Bird will notify owners, and dealers will repair the buses free of charge. The safety recall is expected to begin on, or about, August 24, 2012. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's recall campaign number is R12VH.

**12V-359**

Blue Bird is recalling model year 2013 All American and Vision non-school buses manufactured from April 30, 2012, through June 23, 2012. Driver's seat belts may have been inadvertently installed with mismatched buckles. The latch plate (tongue) on one style buckle may mate up to another style buckle receiver but the latch plate may not be properly engaged. Therefore, they fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 209, "Seat Belt Assemblies." Should this condition occur, the seat occupant may not be properly restrained and could be injured in an accident or sudden stop. Blue Bird will notify owners, and dealers will repair the buses free of charge. The safety recall is expected to begin on, or about, August 24, 2012. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's recall campaign number is R12VH.

**12V-360**

Keystone RV Company (Keystone) is recalling certain model year 2013 Outback and Sydney recreational vehicles manufactured from July 10, 2012, through July 17, 2012. These vehicles may have been manufactured with two carbon monoxide detectors and no smoke detector. In the event of a fire, the lack of a fire detector can lead to an increased risk of personal injury and/or property damage. Keystone will notify owners, and dealers will inspect and install, as necessary, a fire detector, free of charge. The safety recall is expected to begin in August 2012. Owners may contact Keystone at 1-866-425-4369. Keystone's recall campaign number is 12-179.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

**12V-361**

Corp. Micro Bird, Inc. (Micro Bird) is recalling certain model year 2011 and 2012 Micro Bird G5 school buses manufactured from April 1, 2011, through June 26, 2012, equipped with ProLo roof escape hatches made by Specialty Manufacturing, Incorporated. Increased friction between the rear plate assemblies, p/no. 009327, and the nylon rear pop-up support, p/no. 008956, may result in an opening force of the ProLo roof hatches that exceeds Federal standard requirements. Thus, these hatches fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 217, "Bus Emergency Exits and Window Retention and Release." In the event of an emergency, egress of the bus may be hindered possibly resulting in injury to the vehicle occupants. In the event of an emergency, egress of the bus may be hindered possibly resulting in injury to the vehicle occupants. Micro Bird will notify owners. Specialty Manufacturing, Inc. (SMI) will provide service kits along with repair instructions to dealers and owners, free of charge. The safety recall will begin in early August 2012. Owners may contact Micro Bird at 1-819-477-2012 or SMI at 1-800-951-7867. This is Micro Bird recall number 12-053-RHU.

**12V-362**

QingQi Group Motorcycle Co. Ltd., through its designated agent ZAP, is recalling all model year 2008 ZAP Xebra motorcycles manufactured from January 1, 2008, through December 31, 2008. These motorcycles do not conform to the requirements of Federal Motor Vehicle Safety Standard No. 122, "Motorcycle Brake Systems." The motorcycles were produced without a separate brake fluid reservoir for each brake circuit, with each reservoir filler opening having its own cover, seal, and cover retention device. Without a separate reservoir for each brake, having its own cover, seal, and cover retention device, fluid for one brake circuit may move to the other. If this happens, both reservoirs could lose fluid as a result of a fluid leak in one brake circuit and compromise the stopping ability of the braking system, increasing the risk of a crash. ZAP will notify owners and ZAP will install or send each owner a remedy kit to bring the vehicles into compliance. ZAP has not provided a notification schedule. Owners may contact ZAP Customer Service at 1-800-251-4555.

**12V-363**

Crossroads is recalling certain model year 2013 Crossroads Cruiser recreational trailers, manufactured from April 19, 2012, through July 17, 2012. These vehicles were manufactured with incorrect information on the Federal Identification Tag, Tire and Loading Information Label and the Recreational Vehicle Cargo Carrying Capacity Label. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 120, "Tire Selection and Rims for Motor Vehicles Other Than Passenger Cars." An inaccurate label could lead to improper vehicle loading specifications which could lead to a tire failure which may result in personal injury or property damage. Crossroads will notify owners and provide corrected labels. Owners may contact Thor industries at 1-937-596-7965 or Crossroads at 1-260-593-2866.

**12V-364**

Dutchmen is recalling certain model year 2013 Coleman 192 and Dutchmen 196 recreational vehicles manufactured from April 12, 2012, through July 9, 2012. These vehicles have been manufactured with the propane line in close proximity to the rear axle hanger which could be damaged by the rear axle hanger bolt

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

during travel. If this occurs, a leak could develop, and in the presence of an ignition source could result in a fire and/or explosion, increasing the risk of personal injury or property damage. Dutchmen will notify owners, and dealers will inspect and, as necessary, replace and re-route the propane line, free of charge. Dutchmen has not provided a notification schedule. Owners may contact Dutchmen at 1-574-537-0700.

**12V-365**

Gulf Stream Coach, Inc. (GSC) is recall certain model year 2006 through 2008 Crescendo, Sun Voyager, Independence, Bounty Hunters, and Yellowstone Class A diesel pusher motor homes built on Freightliner Custom Chassis (FCCC) from March 18, 2005, through December 2009. These motorhomes chassis are equipped with Bosch hydraulic disc brakes which, when exposed to long periods of time of non-driving, may experience diametrical brake caliper piston growth and reduced piston to bore clearance potentially leading to brake drag and overheating resulting in reduced brake performance. Reduced brake performance increases the risk of a crash. FCCC will notify owners, and dealers will repair the vehicles, free of charge. Owners may contact GSC at 1-800-289-8787 or Daimler Trucks/FCCC at 1-800-547-0712. Daimler Trucks recall campaign number is FL-628.

**12V-366**

Keystone RV Company (Keystone ) is recalling certain model year 2013 Bullet Premier 31BHPR travel trailers, manufactured from April 2, 2012, through July 24, 2012. These vehicles were manufactured with incorrect information on the Federal Identification Tag, Tire and Loading Information Label and the Recreational Vehicle Cargo Carrying Capacity Label. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 120, "Tire Selection and Rims for Motor Vehicles Other Than Passenger Cars." An inaccurate label could lead to improper vehicle loading specifications which could lead to a tire failure which may result in personal injury or property damage. Keystone's recall number is 12-180. Keystone will notify owners and provide corrected labels. The recall is expected to begin during August 2012. Owners may contact Keystone RV Company at 1-574-535-2100.

**12V-367**

Cottrell is recalling certain model year 2006-2011 trailers equipped with a Meritor axle. The bearing system has exhibited low durability life in certain vehicle applications. Prolonged use of the system in these applications can result in the degradation of the bearing grease, thereby potentially resulting in a bearing failure and subsequent wheel end fire. Cottrell is working with the Meritor to identify and repair the vehicles that contain the subject axles free of charge. The recall is expected to begin during August 2012. This recall campaign supersedes previous recall campaign 11V-594. Trailers that were repaired under the previous campaign will also need to be repaired under this campaign. Owners may contact Meritor OnTrac Performance Plus Call Center at 1-866-668-7221, option 5.

**12V-370**

Newmar Corporation (Newmar) is recalling certain model year 2008 and 2009 Grand Star Class A motorhomes built on Freightliner Custom Chassis (FCCC) from January 25, 2007, through May 22, 2009. These motorhomes chassis are equipped with Bosch hydraulic disc brakes which, when exposed to long periods of time of non-driving, may experience diametrical brake caliper piston growth and reduced piston to bore

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JULY 2012**

*Published August 9, 2012*

clearance potentially leading to brake drag and overheating resulting in reduced brake performance. Reduced brake performance may lead to a vehicle crash. Owners will be notified by Daimler Trucks/FCCC, and repairs will be performed by authorized FCCC dealers free of charge. Owners may contact Newmar at 1-574-773-7791 or Daimler Trucks at 1-800-547-0712. Daimler Trucks' recall campaign number is FL-628.

**12V-371**

Dutchmen is recalling certain model year 2010 through 2013 Breckenridge brand travel trailers manufactured from May 26, 2009, through May 2, 2012, and equipped with Atwood Mobile Products (Atwood) furnaces. The furnaces were produced with a defective gas control valve which can stick in the open position. If the gas valve sticks in the open position, gas could leak out and, in the presence of an ignition source, result in a fire. Dutchmen will notify owners, and dealers will repair the furnaces, free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact Breckenridge Warranty Service Department at 1-800-223-2376.

**12V-382**